

## A-SERIES AUTOMATED PLASMA CUTTING SYSTEMS



# AUTOMATED PLASMA CUTTING.

#### The Automated Plasma Cutting Systems are based on the proven ESAB<sup>®</sup> platform. The A-Series offers standard features to meet the needs of many automated applications.

With all the advantages of 1Torch and proven ESAB's reliability, the automated A-Series delivers the best in productivity, precision and performance.

- A powerful 80% Duty Cycle to handle all-day production cutting in the toughest environments.
- Single phase 230V for all units including the A120.
- Light-weight, compact design and convenient mounting feet allow for easy mounting in any application.
- Valve-in-torch design reduces cycle time between parts and increases productivity.
- CNC Interface connection is located on the rear of the power supply offering "Start/Stop", "OK to MOVE" and divided arc voltage signals.

# FEATURES.



- Software automatically detects the torch that is attached and switches between automation and manual modes.
- Dedicated automation software improves cycle time and performance in many applications.
- The A-Series systems include the SL100<sup>®</sup> SV 1Torch<sup>®</sup> start technology eliminating the electronic interference that can occur with other designs. The 1Torch provides quick, reliable starts and a strong pilot arc to pierce heavy plate. With auto-pilot restart, it can also cut expanded metal quickly and easily.
- The SL100 SV Torch comes with standard ATC Quick Disconnect in lengths of 25 ft (7.6 m), 35 ft (10.7 m) and 50 ft (15.2 m) Longer torch leads up to 100 ft (30.5 m) available.



#### **Multi Voltage Capable**

Multi voltage input power selection\*
\* US/Canada Models Only

#### **Mobility**

Lightweight design improves portability (Reduced nearly 50%).

#### **Accessory Compartment**

Holds extra tips and consumables

#### **Standard Accessories**

Standard Keyhole Mounting Feet

# SUPERIOR CUTTING PERFORMANCE.

### SureLok® Electrode Technology

The innovative, patented, self-locking electrode mechanism eliminates the need for an installation tool and ensures

precise electrode and tip alignment. Both the electrode and tip are

stationary which results in a highly defined arc and precise cuts. SureLok alignment also means longer tip and electrode life and reduced operating costs.

#### Total Gas Management<sup>™</sup>

The SL100<sup>®</sup> SV 1Torch<sup>®</sup> eliminates the need for a separate plasma gas distributor. Each tip includes plasma

gas ports uniquely tuned to optimize cutting performance at its rated current. Select from 40, 60, 80, 100 or 120 Amp tips to optimize your cutting. The result is



Total Gas Management. Precision gas control,

longer consumable parts life and better cut performance.

#### **Superior Quality at All Amperages**

Whether you are fabricating thick plate or cutting ornamental shapes, the Automation Series is perfect for the job.

At 120 Amp output, the A120 produces the BEST CUT on 1/2" (12 mm) mild steel plate at 70 IPM (1.86 m/min). For those cutting intricate shapes, select low amperage tips for kerf widths less than 0.045" (1.14 mm) wide.

Whether you cut plate, HVAC duct work or ornamental shapes, the A-Series is right for you.

### Start Cartridge

High Frequency has been completely eliminated from the plasma system. A patented component called the "Start Cartridge" sits between the tip and electrode.

The Start Cartridge is in contact with the tip while the torch is inactive. When a start signal is given, air forces the cartridge to break contact with the tip and the pilot arc is started. This unique design allows the pilot arc



to start without moving either the tip or electrode, resulting in better parts life, cut performance and reliability. The start cartridge is the only moving part in the SL100SV torch.

### **Choice of Tip Shielding**

Choose from two consumable styles:

- Exposed Tip for cutting thin sheet at low power & narrow kerf.
- Shielded Tip for heavier plate piercing and cutting.



Note: Use the Ohmic Clip with the Shielded Tip design if ohmic plate sensing is required


Exposed Tip Shielded Tip



#### **PRODUCT SELECTION & ORDERING PROCESS**

	SPECIFICATIONS	A40	A60	<b>A80</b>	A120
Production Piercing & Cutting Capacity	Gauge (0.5 mm – 2 mm)	*	*	*	*
	1/4" (6 mm)	*	*	*	*
	3/8" (10 mm)		*	*	*
	1/2" (12 mm)			*	*
	5/8" (15 mm)				*
Applications	Sheet Metal – Ductwork, Artwork, Trailer Panels	*	*	*	*
	Light Fabrication - Kitchenware, Autobody Panels, Pipe		*	*	*
	Medium Fabrication - Industrial Components, Truck Frame & Body			*	*
	Heavy Fabrication – Heavy Equipment Components, Structure Components, Pipe				*
Duty	High Production – 80% Duty Cycle	*	*	*	*
ORDERING F	PROCESS				
STEP 1	Choose power supply by cutting thickness (Amperage) and input vo				
STEP 2	Choose lead length of the torch				
STEP 3	Choose spare parts kit by amperage				
STEP 4	Choose language of the manual				

## CONSUMABLE PARTS.

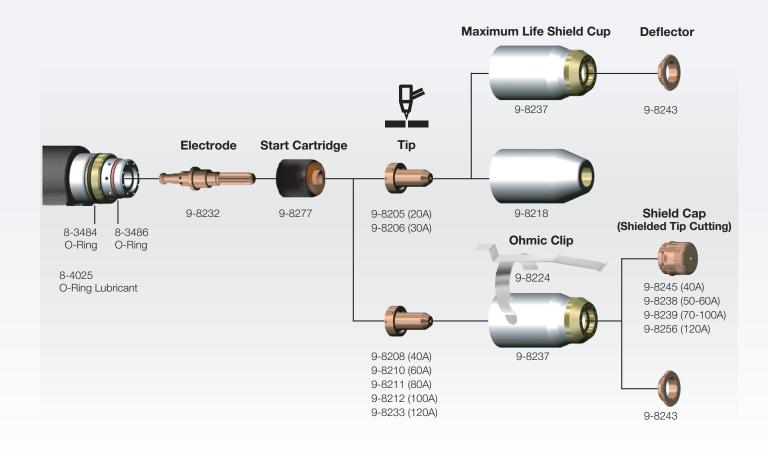

#### ACCESSORIES

#### **CNC Cables**

9-1008 25 ft (7.6 m) 9-1010 35 ft (10.6 m) 9-1011 50 ft (15.2 m)

#### **1Torch® Automation Leads Packages**

 SL100® SV180° - (Torch/Leads)

 7-4001
 25 ft (7.6 m)

 7-4002
 35 ft (10.6 m)

 7-4003
 50 ft (15.2 m)

 7-4004
 75 ft (23 m)

 7-4005
 100 ft (30.5 m)

#### Hand Torches

 SL60® - (Torch/Leads)

 7-5204
 20 ft (6.1 m)

 7-5205
 50 ft (15.2 m)

 SL100 - (Torch/Leads)

 7-5206
 20 ft (6.1 m)

 7-5208
 50 ft (15.2 m)



#### Two Stage Air Filter Kit Cat. No. 9-9387 1st Stage Replacement Cartridge 9-1021 2nd Stage Replacement Cartridge 9-1022

Pinion Assembly Cat. No. 7-2827 (1 3/8" (35 mm) Diameter)

Remote Pendant Control Cat. No. 7-3460 20 ft (6.1 m) Remote Pendant Control for your mechanized application.

Hand Pendant Extension Cat. No. 7-7744 25 ft (7.6 m)







## SELECTION GUIDE.



### **A-SERIES UNIT SPECIFICATIONS\***

		A40	A60			A80			A120			
Rated Output	40 Amps			60 Amps 8			80 Amps			120 Amps		
Output Range			20 - 60 Amps @ 80% DC, 80 Amps Max., Adjustable			30 - 80 Amps @ 80% DC, 100 Amps Max., Adjustable			30 - 120 Amps @ 80% DC, 120 Amps Max., Adjustable			
Production Piercing & Cutting Capacity	1/4" (6 mm)			3/8" (10 mm)			1/2" (12 mm)			5/8" (15 mm)		
Maximum Piercing & Cutting Capacity	1/2" (12 mm)			5/8" (15 mm)			3/4" (20 mm)			3/4" (20 mm)		
Maximum Edge Start	1" (25 mm)			1" (25 mm)			1¼" (30 mm)			11⁄2" (40 mm)		
Input Volts	208-230/460V, 1/3 ph, 50/60 Hz 380/400V, 3 ph, 50/60 Hz 600V, 3 ph, 60 Hz		208-230/460V, 1/3 ph, 50/60 Hz 380/400V, 3 ph, 50/60 Hz 600V, 3 ph, 60 Hz			208-230/460V, 1/3 ph, 50/60 Hz 380/400V, 3 ph, 50/60 Hz 600V, 3 ph, 60 Hz			208-230/460V, 1/3 ph, 50/60 Hz 380/400V, 3 ph, 50/60 Hz 600V, 3 ph, 60 Hz			
	Volts	1 Phase	3 Phase	Volts	1 Phase	3 Phase	Volts	1 Phase	3 Phase	Volts	1 Phase	3 Phase
	208V	47	26	208V	75	40	208V	99	46	208V	126	61
	230V	45	24	230V	72	39	230V	95	49	230V	118	56
Input Amps @ Max Output	380V	-	16	380V	-	17	380V	-	29	380V	-	35
Max Output	400V	-	16	400V	-	17	400V	-	28	400V	-	36
	460V	31	16	460V	44	21	460V	59	29	460V	76	37
	600V	-	13	600V	-	16	600V	-	22	600V	-	28
Kilowatt Output	6.3 kW	•		9 kW			12 kW	<b>I</b>		15.4 kW	-	
Duty Cycle			80% @ 60 Amps 100% @ 50 Amps		80% @ 80 Amps 100% @ 70 Amps		80% @ 120 Amps 100% @ 100 Amps					
MAX OCV	260 VDC			260 VDC			260 VDC			260 VDC		
Gas Type	Air @ 75 psi (5.2 bar) @ 6.7cfm (189 lpm)			Air @ 75 psi (5.2 bar) @ 6.7cfm (189 lpm)			Air @ 75 psi (5.2 bar) @ 6.7cfm (189 lpm)			Air @ 80 psi (5.5 bar) @ 6.7cfm (189 lpm)		
Weight	43 lbs (19.5 kg) - Unit, Power Cable, (Torch and Leads)			43 lbs (19.5 kg) - Unit, Power Cable, (Torch and Leads)			63 lbs (28.6 kg) - Unit, Power Cable, (Torch and Leads)			63 lbs (28.6 kg) - Unit, Power Cable, (Torch and Leads)		
Dimensions	H 13.5" (343 mm) x W 9.75" (248 mm) x L 21.0" (533 mm)		H 13.5" (343 mm) x W 9.75" (248 mm) x L 21.0" (533 mm)			H 13.5" (343 mm) x W 9.75" (248 mm) x L 26.0" (660 mm)			H 13.5" (343 mm) x W 9.75" (248 mm) x L 26.0" (660 mm)			
Work Cable	20' (6.1 m)		20' (6.1 m)			20' (6.1 m)			20' (6.1 m)			
Control	CNC rear panel connector, Start/Stop and OK to Move, divided arc voltage		CNC rear panel connector, Start/Stop and OK to Move, divided arc voltage		CNC rear panel connector, Start/Stop and OK to Move, divided arc voltage		CNC rear panel connector, Start/Stop and OK to Move, divided arc voltage					
Input Power Cable	10' (3 m) with plug (208/230V) 6' (2 m) without plug (400V)		10' (3 m) with plug (208/230V) 6' (2 m) without plug (400V)			10' (3 m) with plug (208/230V) 6' (2 m) without plug (400V)			10' (3 m) with plug (208/230V) 6' (2 m) without plug (400V)			
Certifications	IP-23C, CSA, I	NTRL/C, CE	, CCC	IP-23C, CSA, NTRL/C, CE, CCC			IP-23C, CSA, NTRL/C, CE, CCC			IP-23C, CSA, NTRL/C, CE, CCC		
Torch Configuration		_	_				·		_	·		
Torch					SL100	<sup>®</sup> SV w/ AT(	C®, 180° Auto	omation				

\* Subject to change without notice

## AUTOMATED PLASMA CUTTING.

#### **CUTTING SPEED CHART FOR A-SERIES SYSTEMS**

Material	Thickness (Inch)	Speed (IPM)	Amps	Plasma /Shield	Thickness (mm)	Speed mm/min
	20 ga.	160	40	Air/Air	1	3990
	16 ga.	140			2	2920
	3/16	55			3	1810
	1/4	40			5	1345
	3/16	100	60	Air/Air	4	3650
	1/4	80			6	2145
	3/8	50			10	1180
	1/2	26			12	795
	1/4	100	80	Air/Air	6	2745
Mild Steel	3/8	42			10	1060
	1/2	40			12	1025
	5/8	18			15	610
	3/8	75	100	Air/Air	10	1790
	1/2	45			12	1310
	3/4	20			20	490
	3/8	85	120	Air/Air	10	2100
	1/2	70			12	1860
	5/8	45			15	1320
	3/4	30			20	720
	16 ga.	50	40	Air/Air	2	1140
	3/16	30			3	980
	1/4	18			5	715
	3/16	90	60	Air/Air	4	2865
	1/4	65			6	1790
	3/8	30			10	725
	1/2	21			12	580
Stainless	1/4	100	80	Air/Air	6	2765
Steel	3/8	45			10	1070
	1/2	26			12	765
	3/8	65	100	Air/Air	10	1575
	1/2	45			12	1255
	5/8	20			15	685
	3/8	100	120	Air/Air	10	2390
	1/2	60			12	1750
	5/8	40			15	1160
	16 ga.	170	40	Air/Air	2	3500
	3/16	75			3	2350
	1/4	30			5	1740
	3/16	170	60	Air/Air	4	5230
	1/4	85			6	2640
	3/8	45			10	1085
	1/2	30			12	845
	1/4	110	80	Air/Air	6	3190
luminum	3/8	55			10	1330
	1/2	38			12	1060
	5/8	26			15	745
	3/8	65	100	Air/Air	10	1575
	1/2	45			12	1255
	3/4	20			20	470
	3/8	110	120	Air/Air	10	2660
	1/2	75			12	2100
	5/8	50			15	1445





**NOTE:** The cutting speed chart data is subject to change without notice. Take care in comparison. The speeds noted above are best cut quality speeds. Often, competitors show maximum cutting speeds. Although much higher speeds can be achieved, edge quality and bevel angle may be compromised. The capabilities shown in this table were obtained by using new consumables, correct gas and current settings, accurate torch height control and with the torch perpendicular to the workpiece. The operating chart does not list all processes available for the A-Series plasma systems. Please contact ESAB for more information.

1TORCH, SL100SV and ATC, are trademarks of ESAB, and registered with the U.S. Patent and Trademark Office, and are the subject of trademark registrations and pending applications in numerous other countries. For information on trademark registrations of ESAB, contact the local trademark offices in the countries of interest.

# **UNRIVALED** SERVICE AND SUPPORT.

A-Series, like all ESAB products, is backed by our commitment to superior customer service and support. Our skilled customer service department is prepared to quickly answer any questions, address problems, and help with the maintenance and upgrading of your machines. And our products are backed with the most comprehensive warranty in the business.

With ESAB, you can be sure you purchased a machine that will meet your needs today and in the future. Product and process training is also available. Ask your ESAB sales representative or distributor for a complete ESAB solution.

For more information visit **esab.com**.







XA00183226 8/16